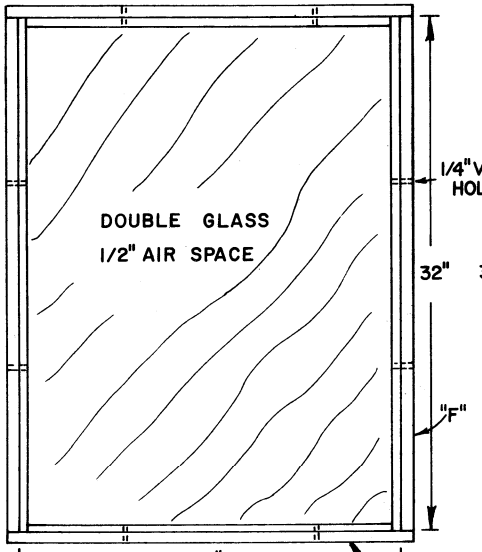

TOP VIEW OF LID

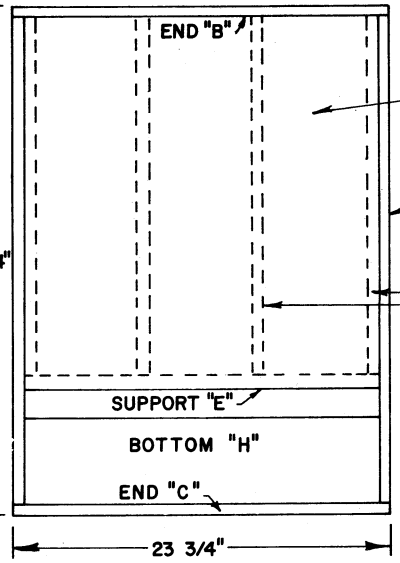

TOP VIEW OF BOX

NO SCALE

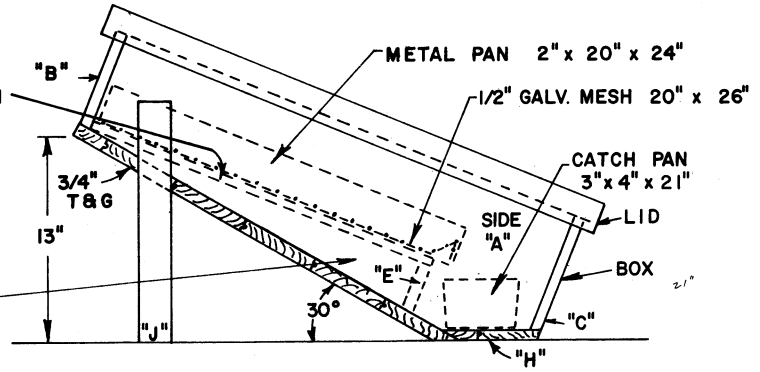

SIDE VIEW, COMPLETE UNIT

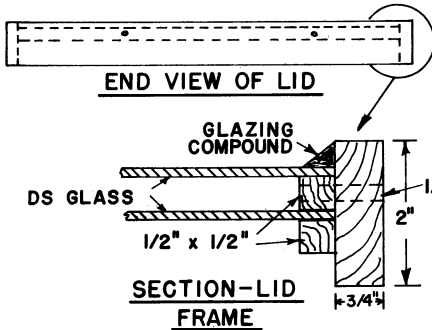

SECTION-LID FRAME

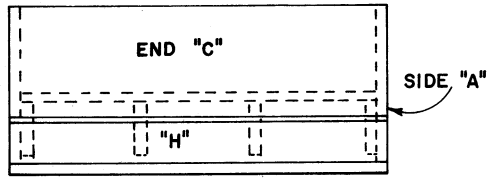

END VIEW OF BOX

NO SCALE

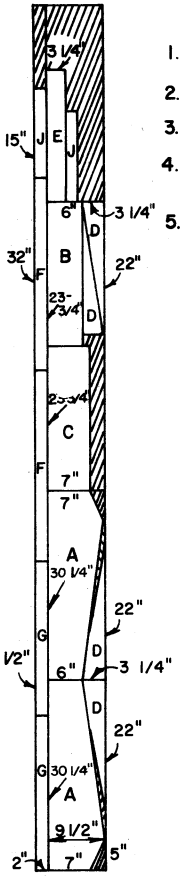

CUTTING DIAGRAM

1" x 12" x 12' BOARD — (3/4" x 11 1/2 " x 12')

NOTES

1. PAINT INSIDE WHITE.
2. PAINT OUTSIDE BLACK.
3. SEAL ALL CRACKS.
4. PLACE IN PROTECTED PLACE ON SOUTH SIDE OF A BUILDING.
5. REMOVE WAX AND HONEY WHEN MOST COMBS ARE MELTED. THE HONEY SHOULD BE DISCARDED.

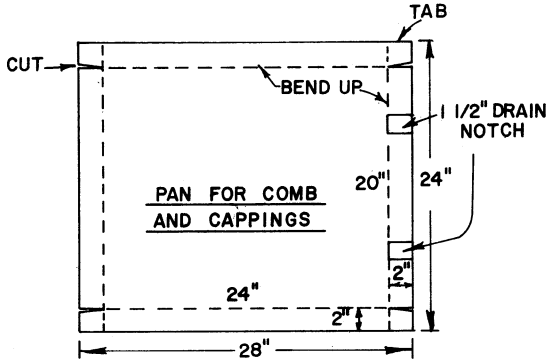

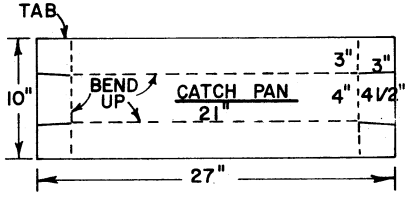

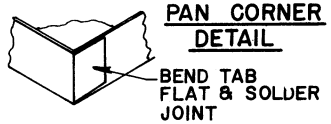

CUTTING DIAGRAMS FOR 24 GA. GALVANIZED STEEL PANS

NO SCALE

NO SCALE

BASED ON: PENN STATE UNIV. PLAN NO. 790-301

COOPERATIVE EXTENSION WORK IN AGRICULTURE AND HOME ECONOMICS
STATE OF TENNESSEE
UNIVERSITY OF TENNESSEE
AND
UNITED STATES DEPARTMENT OF AGRICULTURE COOPERATING

SOLAR BEESWAX EXTRACTOR

PA '77	6265	SHEET 1 OF 1